

# Input / Output Signals


**PLEASE PAY ATTENTION ABOUT THE CONNECTIONS BETWEEN OUTPUT SIGNAL OF THE MOTOR AND THE PLC !**

**OUTPUTS ARE NOT PROTECTED AGAINST EXCESSIVE CURRENT REQUEST (MAX 100mA).**

**IF THE OUTPUTS WILL BE CONNECTED TO GROUND OR LOW RESISTANCE LOAD WHEN THE MOTOR IS ENABLED THE OUTPUT PNP TRANSISTOR WILL BE DAMAGED PERMANENTLY.**

## Input signals

the inputs are protected from inversion and overvoltage. The logic level is 24VDC.

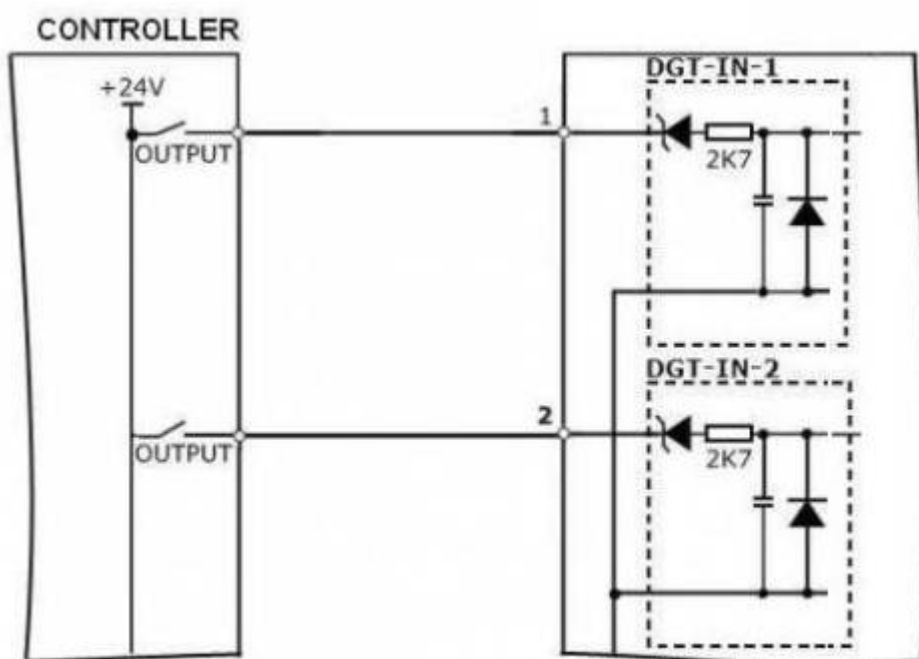


## Output Signals


### PNP - Default type (Default type)

The digital output signals are by default PNP type (without internal pull-down).  
The absolute current capability is **100mA per output lines**.

**FOR CORRECT OPERATION TO AVOID DAMAGED USE TYPE 2, EN 61131-2 Input characteristic curve on PLC Input.**  
**IN THIS CASE THE CURRENT DRAW FROM THE PLC INPUTS IS TYPICALLY < 10mA**

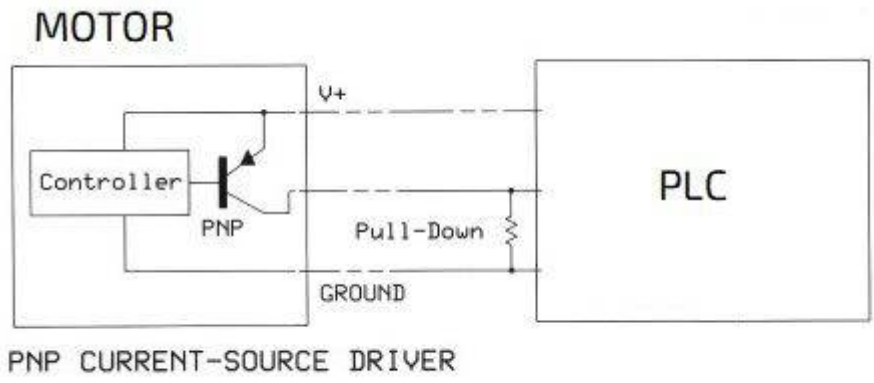

### NPN Type (only on request)

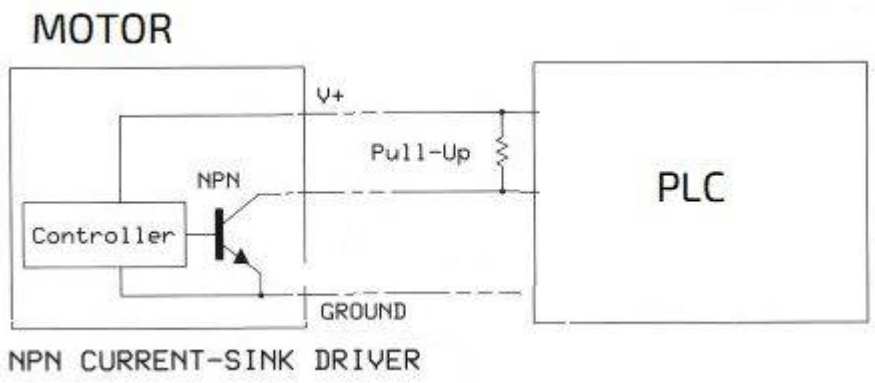

From:  
<https://dokuwiki.nilab.at/> - NiLAB GmbH  
**Knowledgebase**

Permanent link:  
[https://dokuwiki.nilab.at/doku.php?id=integrated\\_drive\\_motors:io\\_signal](https://dokuwiki.nilab.at/doku.php?id=integrated_drive_motors:io_signal)

Last update: **2025/06/17 06:03**

